

This Page Is Inserted by IFW Operations  
and is not a part of the Official Record

## **BEST AVAILABLE IMAGES**

Defective images within this document are accurate representations of the original documents submitted by the applicant.

Defects in the images may include (but are not limited to):

- BLACK BORDERS
- TEXT CUT OFF AT TOP, BOTTOM OR SIDES
- FADED TEXT
- ILLEGIBLE TEXT
- SKEWED/SLANTED IMAGES
- COLORED PHOTOS
- BLACK OR VERY BLACK AND WHITE DARK PHOTOS
- GRAY SCALE DOCUMENTS

**IMAGES ARE BEST AVAILABLE COPY.**


**As rescanning documents *will not* correct images,  
please do not report the images to the  
Problem Image Mailbox.**

# Laser Welding Repair Of Advanced Superalloy Components


Yiping Hu, Bill Hehmann

*Honeywell-Aerospace Greer Engine Services*

*December 2, 2003*

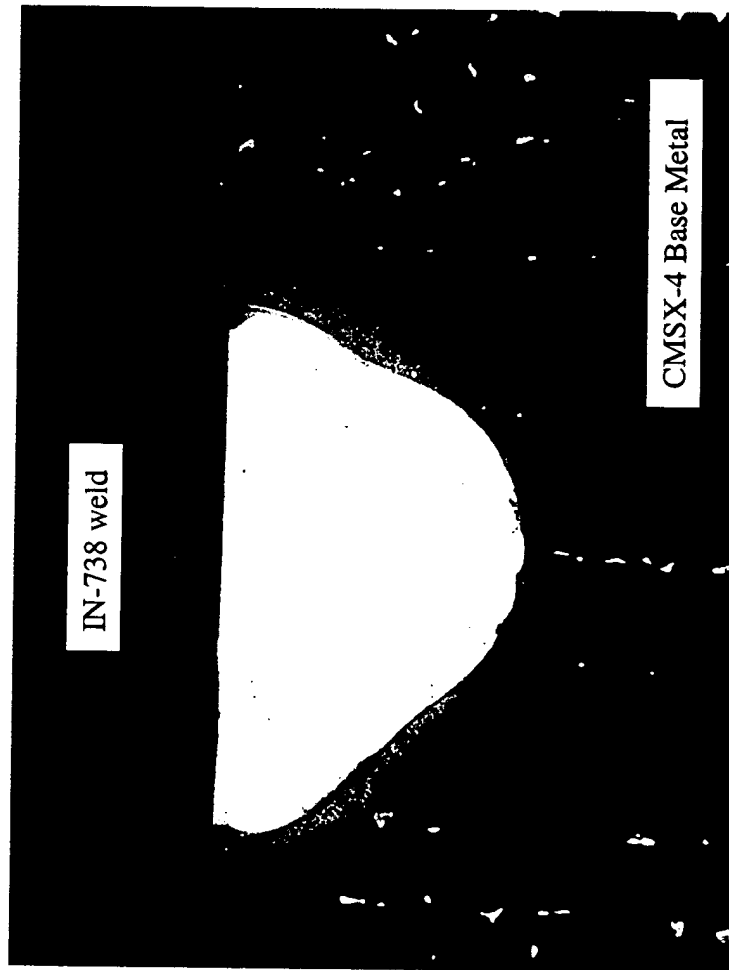

**Figure 2**

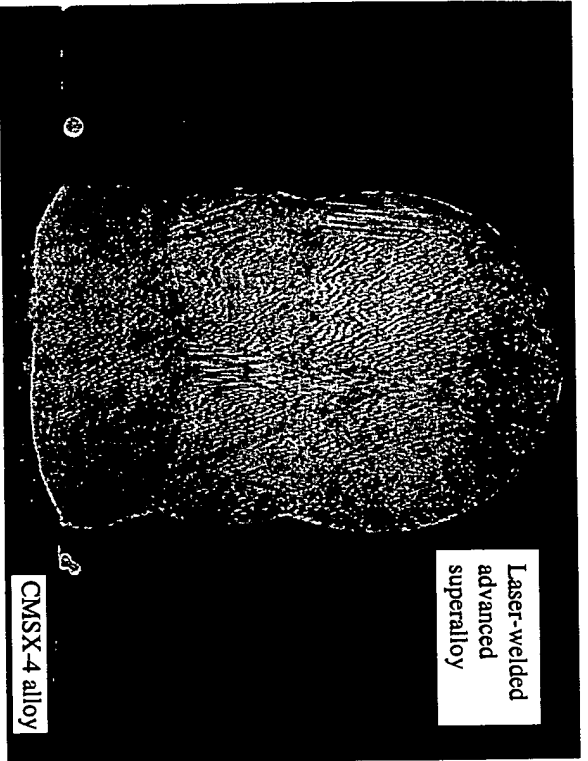

Figures 3

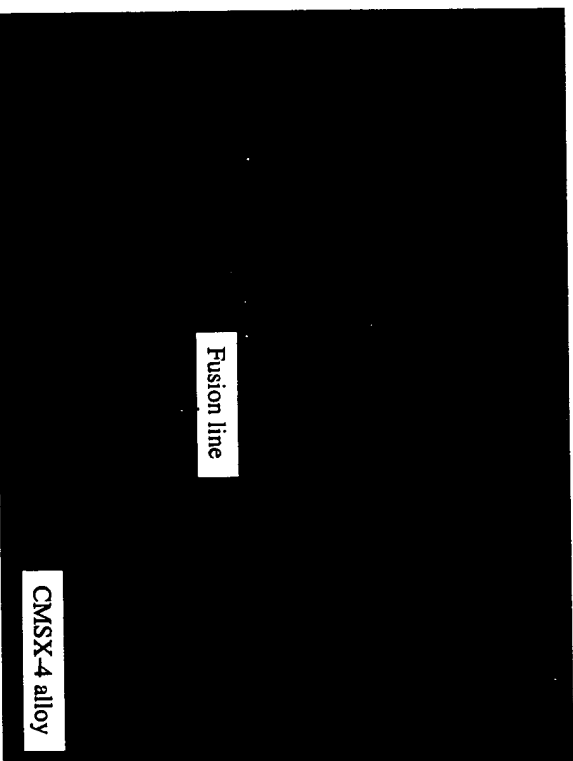


Figure 4

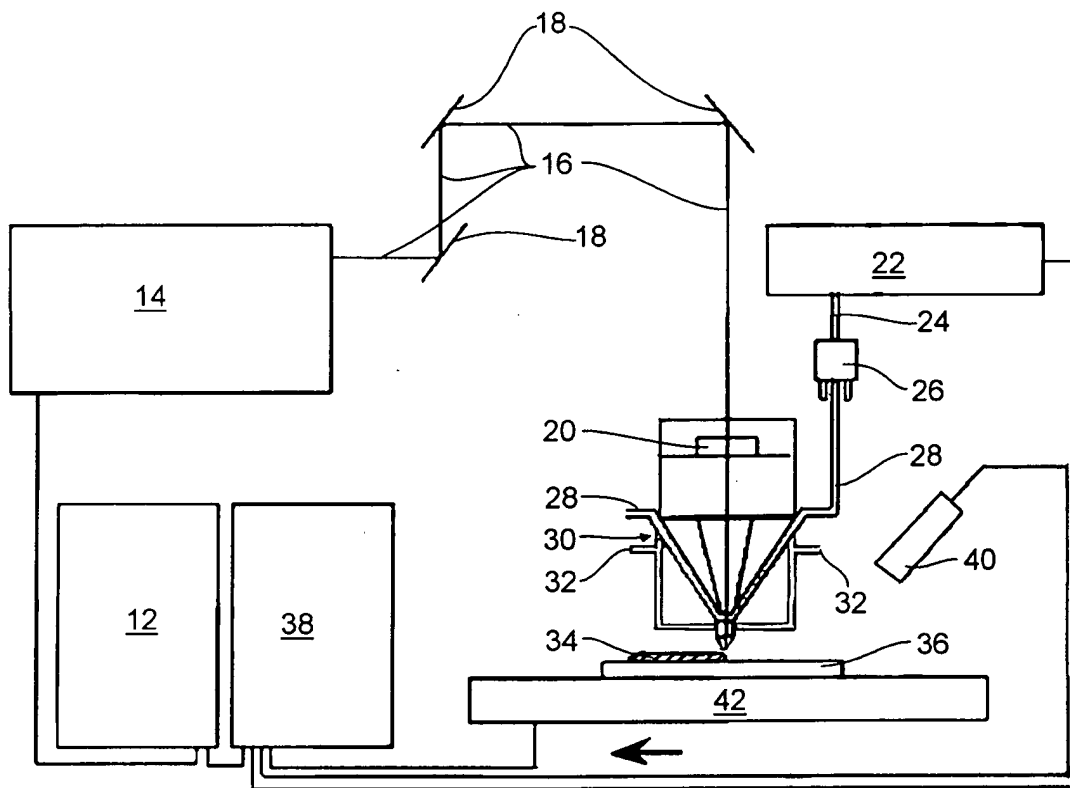


Fig. 1